

GPOP - Issue Review System

Part Number: 52059718A\$, 52059729A\$

Part Description: Fuel Tank

Issue Description: 1) Before replacing this part due to fault code P0441, check for restriction due to plastic over-flash in the Purge Hose Port of the Intake Manifold for the ERB (3.6L engine only). If there is flash in the Purge Hose Port of the Intake Manifold, then remove the flash with a 5/32" drill bit and clean the Intake Manifold of any flash debris. 2) Before replacing this part due to "Hard to Fuel Fill" condition, check the Fuel Filler Tube for restriction in the Vent Tube. If there is blockage, then replace the Fuel Filler Tube. Contact Sylvia H. Lopez at (248) 520-9734 before replacing the Tank. If you do not receive a call back within 15 minutes, then continue the repair.

~ _____ ~
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
