

## GPOP - Issue Review System

**Part Number:** 04593949A\$, 04891731A\$, 04861962A\$, 05147069A\$, 05147125A\$, 52129436A\$

**Part Description:** Fuel Tank and Fuel Evap System Components

**Issue Description:** 1) For JK MIL On – P0441: Before replacing this part due to fault code P0441, check for restriction due to plastic over-flash in the Purge Hose Port of the Intake Manifold. If there is flash in the Purge Hose Port of the Intake Manifold and the vehicle is 2016 MY then replace the Intake Manifold and send to QEC. Otherwise, remove the flash with a 5/32" drill bit and clean the Intake Manifold of any flash debris. If the fault code P0441 continues after repairing the Intake Manifold, then send Freeze Frame data of P0441 to Michael.Ade@FCAGroup.com and contact Sylvia Lopez at cell number (248) 520-9734. If you don't receive response within 15 minutes, please continue with the normal repair procedure.

2) For RT MIL On – P0456: If ESIM needs to be replaced for fault code P0456, check the Vapor Line, Fresh Air Filter and the Black Frame Rail Blocker for water ingestion. If water ingestion is found, then replace the ESIM part number 04861962AB and the Jumper, Vent Recirculation Tube part number 04721757AI. Please contact Release Engineer Alfredo Salituro @ 213-700-5359 before performing repair service. If you do not receive a response within 15 minutes, please continue with the normal repair procedure.

~  
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.  
~