



Technical Journal

TITLE:

Headlamp/Turn indicator DIM message

REF NO: TJ 32851.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2017-07-05	STATUS DATE: 2017-07-11
FUNC GROUP: 3521	FUNC DESC: Headlamp, complete	Page 1 of 2	

“Right first time in Time”

Attachment

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
246							2018-2018		0000390-9999999	201717-999952

CSC Customer Symptom Codes

Code	Description
IV	Text window and warning symbol/Text message

VST Operation Number

VST Operation Number	Description
36001-2	Diagnostic trouble codes read / reset / known Diagnostic trouble codes with VIDA

DTC Diagnostic Trouble Codes

Control Module	Code	Fault Type
CEM	U113000	Intermittent
CEM	U113100	Intermittent
CEM	B153308	Intermittent
CEM	B159282	Intermittent
CEM	B159382	Intermittent



Text

DESCRIPTION:

DIM: Driver information module

CEM: Central electronic module

SW: Software

DTC: Diagnostic trouble codes

If DIM messages “Headlamp System service required” and/or “Turn Indicator System malfunction” appears, and 2 or more of below listed DTC’s are set, then see advice under service.

CEM-U113000

CEM-U113100

CEM-B153308

CEM-B159282

CEM-B159382

SERVICE:

Erase the DTC’s.

If the DTC’s are set again then send a Vehicle Report for advice.

Do not replace any components due to these DTC’s.

New SW is under development, planned to be released week 28, 2017.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area “Vehicle Report” and sub concern area “Support Needed”, use function group 3521.