SSM 46322	Some 2015-2016 Focus vehicles if equipped with remote start and built on or before 17-Oct-2016 may exhibit vehicle stall with a malfunction indicator lamp (MIL) and diagnostic trouble code (DTC)P1594. This may be due to wheel speed sensor reporting movement of the vehicle while stopped. To correct this condition, update the Body Control Module (BCM) to the latest calibration level using integrated diagnostic software (IDS) version 103.03 or higher. Refer to workshop manual (WSM) section 419 to perform the BCM updating procedure. Make sure the IDS is connected to the
	internet when entering module reprogramming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com Use causal part 14A068 and applicable labor operations in section 10 of the SLTS manual.