

SSM 46364	Some 2017 MKZ/Continental/Fusion vehicles equipped with the 2.7L/3.0L engine and built on or before 6-Oct-2016 may exhibit a rough idle in neutral or park at normal operating temperature or after a hot restart, white or blue smoke from the exhaust, excessive oil consumption and/or an illuminated malfunction indicator lamp (MIL) with diagnostic trouble codes (DTCs) P0300, P0301, P0302, P0303, P0304, P0305, P0306 and/or P0316. Suspect the cylinder heads as the cause for this issue. If the vehicle also exhibits P0524 and/or P06DD suspect the long block as the cause for this issue.
--------------	--