

April 11, 2017

06125 Version 1

Flapping or Fluttering from the Left Rear of the Vehicle

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2014–16	Accord (No Accord Hybrid)	4-Door	ALL
2017	Accord	4-Door	1HGCR2...HA000001 thru 1HGCR2...HA167843
			1HGCR3...HA000001 thru 1HGCR3...HA026655

BACKGROUND

There is a flapping or fluttering coming from the left rear of the vehicle when the vent position is set to floor/defrost, recirculation is on, and the blower speed is set to at least three bars.

POSSIBLE CAUSE

The noise is coming from the rear air outlet that is behind the rear bumper on the left side of the vehicle.

CORRECTIVE ACTION

Replace the left rear air outlet.

PARTS INFORMATION

Part Name	Part Number	Quantity
Rear Air Outlet	75450-T2A-A21	1

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
8411A4	Replace the left rear air outlet.	0.5 hr	07404	04201	17-022A	75450-T2A-A01

Skill Level: Repair Technician

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE

1. Remove the rear bumper. Refer to the service information.
2. Replace the left rear air outlet.



3. Install all removed parts.

END