

Service Bulletin

File in Section:

Bulletin No.: 16-NA-237

Date: July, 2016

INFORMATION

Subject: Diagnostic Tip for Passenger Presence System (PPS) with DTC U0155 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	ATS	2016	2017				
	ATS-V						
	CTS						
	CTS-V						

Involved Region or Country	North America and N.A. Export Regions			
Condition	Some vehicles may have a DTC U0155, Lost Communication with Instrument Cluster, stored in the Passenger Presence System (PPS) module. There may or may not be other modules that have stored a U0155 DTC.			

Correction

Important: If U0155 Lost Communication with Instrument Cluster is only set as history and only stored in the PPS module, disregard this DTC for the PPS system.

There is a timing issue between the PPS and IPC when the key is first turned on. The timing issue will correct itself and the DTC will be stored as history. **DO NOT REPLACE ANY MODULE** if PPS is the only module that has set this DTC.

If any other module has set the U0155 Lost Communication with Instrument Cluster, there may be a valid concern with the IPC communication. Follow the proper U-Code diagnostic procedure for the module that reports the U0155.

Version	1
Modified	

