

Service Bulletin

File in Section:

Bulletin No.: 16-NA-094

Date: May, 2016

TECHNICAL

Subject: HVAC Blower Inoperative and/or A/C Button Does Not Illuminate When Pushed

Brand:	Brand: Model:		Model Year:		VIN:		Transmission:
Бгани.	wiodei.	from	to	from	to		
Chevrolet	Spark	2012	2016			All	All

Condition	Some customers may comment that the HVAC blower is inoperative or that the A/C button does not illuminate once pressed.
Cause	This may be caused by contact in the HVAC control being weak, causing transient voltage on blower on/off PIN of the Body Control Module (BCM) when operating blower knob rapidly.

Correction

If you encounter a vehicle with the above concern, replace both the BCM and the HVAC control. Refer to the proper replacement procedures in SI.

Parts Information

Description	Part Number	Model Year/ Usage
MODULE ASM- BODY CONT	13586043	2012-2014
MODULE ASM- BODY CONT	13586273	2015
MODULE ASM- BODY CONT	13594571	2016
CONTROL ASM-HTR & A/C (W/ CABLE CONT)	42479673	2012-2015 Equipped with A/C
CONTROL ASM-HTR & A/C (W/ CABLE CONT)	42479610	2016 Not Equipped with A/C

Description	Part Number	Model Year/ Usage
CONTROL ASM-HTR & A/C (W/ CABLE CONT)	42479674	2012-2015 Not Equipped with A/C
CONTROL ASM-HTR & A/C (W/ CABLE CONT)	42479612	2016 Equipped with A/C

Warranty Information

Labor Operation	Description	Labor Time
4480428*	HVAC Control and BCM Replacement	1.2 hrs**
4-11		

*This is a unique Labor Operation for Bulletin use only.

^{**}Time includes Programming with SPS and all Configuration times.

Version	2
Modified	May 12, 2016 — Updated Parts Information.

