

## **Service Bulletin**

Bulletin No.: 16-NA-168 Date: May, 2016

# INFORMATION

#### Subject: Service Tip for Installing #4 Cross Bar Protective Caps When Replacing Fuel Tank

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Volt	2016	2017				



When servicing the fuel tank and/or replacing the isolator pads, the padding on the new design tank (1) is smaller then the current design (2) and requires the protective caps be installed to the #4 cross bar. <b>Note:</b> The pads on the new design fuel tank are 62 mm wide, 62 mm tall and 8 mm thick.		
<b>Note:</b> When replacing the #4 cross bar, inspect the padding on fuel tank to see which design tank is on the vehicle. If the vehicle has the current design (2) fuel tank, <b>NO</b> protective caps need to be installed. If the vehicle has the new design fuel tank (1), protective caps need to be installed to the #4 cross bar.		

### Correction





4510348





4510536

4509886

Before installing the caps, inspect the bracket on the #4 end cross bar for the HV battery for a key shaped hole. If the bracket doesn't come with the key shaped hole, grind off attaching feature on the back of the caps and retain them using double-sided tape.

#### **Parts Information**

Description	Part Number	Qty
CAP - BRACKET F/TNK	23374928	2

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, <u>DO NOT</u> assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION