

	<b>GROUP</b> <b>Electrical</b>	<b>MODEL</b> <b>2018MY</b> <b>Rio (SC)</b>
	<b>NUMBER</b> <b>PS529 (Rev 1, 01/16/2018)</b>	<b>DATE</b> <b>November 2017</b>



## TECHNICAL OPERATIONS

**SUBJECT:** TPMS LAMP ON AND/OR TRUNK OPEN LAMP ON AND/OR AUDIO SYSTEM INOPERATIVE DURING PDI

### ★ NOTICE

This Pitstop has been revised to include additional information. New/revised sections of this bulletin are indicated by a black bar in the margin area.

This Pitstop contains information regarding the the Audio System inoperative, and TPMS lamp ON, Trunk Open warning lamp ON (even while the trunk is closed), and Master Warning Mode lamp ON in the instrument cluster during PDI. This condition may be caused by the Transportation Fuse being in the OFF position.



**Type A cluster.**



**Type B cluster.**

The 2018 MY Rio (SC), unlike other Kia models, does not have a “FUSE ON” reminder in the instrument cluster if the transportation fuse is OFF.

Verify that the transportation fuse is ON (this can be done by ensuring the yellow transportation fuse tab holder is fully pressed into the In-Panel Junction Box, located in the lower driver’s side crash pad) and that neither the AUDIO (A) nor ROOM (B) fuses are blown.

