

# Preliminary Information

PIP5545 SES Lamp ON with DTC P0324 - Engine Squeak or Belt Noise

#### **Models**

| Brand:                     | Model:   |               | Model Years:   | VIN: |     | Engine:            | Transmissions:  |
|----------------------------|----------|---------------|--|------|-----|--------------------|-----------------|
|                            |          |               |  | from | to  | Engine.            | Transinissions. |
| Buick                      | LaCrosse |               | 2017 - 2018  | ALL  | ALL | 3.6L LGX           | ALL             |
| Cadillac                   | ATS      |               | 2016 - 2018  | ALL  | ALL | 3.6L LGX           | ALL             |
| Cadillac                   | СТ6      |               | 2016 - 2018  | ALL  | ALL | 3.0L LGW, 3.6L LGX | ALL             |
| Cadillac                   | стѕ      |               | 2016 - 2018  | ALL  | ALL | 3.6L LGX           | ALL             |
| Cadillac                   | XT5      |               | 2017 - 2018  | All  | All | 3.6L LGX           | ALL             |
| Chevrolet                  | Camaro   |               | 2016 - 2018  | ALL  | ALL | 3.6L LGX           | ALL             |
| Chevrolet                  | Colorado |               | 2017 - 2018  | ALL  | ALL | 3.6L LGZ           | ALL             |
| GMC                        | Acadia   |               | 2017 - 2018  | All  | All | 3.6L LGX           | ALL             |
| GMC                        | Canyon   |               | 2017 - 2018  | All  | All | 3.6L LGZ           | ALL             |
| Involved Region or Country |          | North America |  |      |     |                    |                 |
| Condition                  |          | from          | ome customers may comment that the SES lamp is on or the engine may have a slight noise coming om the front of engine belt area. his noise may or may not be present at the time vehicle comes in.                         |      |     |                    |                 |
| Cause Vel                  |          | Vehi          | Upon investigation you may find DTC P0324 set in the ECM. Vehicle may also have a slight squeak noise coming from the front of engine. We have determined that at times this code can be set by noise from the water pump. |      |     |                    |                 |

#### Correction:

If this condition is found perform the following inspections prior to diagnosing per SI.

- a) Listen to the water pump with a stethoscope or chassis ears to see if any unusual noise is heard. Compare to similar vehicle to confirm.
- b) Watch the knock retard bank to bank on GDS2, then remove the belt and observe knock retard again. If there is a difference this PI applies.

If no noises are heard or there is no difference in knock retard then this PI does not apply.

Normal SI diagnostics should be followed.

If a noise is heard or a difference is made removing the belt, then replace the water pump and reevaluate the concern.

NOTE: This is a preliminary temporary diagnostic and repair. As more investigation information becomes available this PI will be updated or advanced to a bulletin.

### **Warranty Information**

| Labor Operation | Description            | Labor Time               |
|-----------------|------------------------|--------------------------|
| 4032750         | Water Pump Replacement | Use Published Labor Time |

## **Version History**

| Version  | 1 |
|----------|---|
| Modified |   |

















