



Preliminary Information

PIP5550 Engine Oil Cooler Leak

 
Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Regal	2018	All	All	3.6 LGX	All
Cadillac	XT5	2017 - 2018	All	All	3.6 LGX	All
GMC	Acadia	2017 - 2018	All	All	3.6 LGX	All
Involved Region or Country	North America					
Condition	Some customers may comment that the vehicle has an oil leak from front of vehicle that is visible on the garage floor or driveway. Upon inspection the technician may find an oil leak that is coming from between the oil cooler and oil pan.					
Cause	This condition may be caused by inadequately torqued bolts from the oil cooler to oil pan.					

Correction:

Ensure fasteners (1) that mount the oil cooler to the oil pan are properly torqued. (see below)



The proper torque is 10Nm (89 lb in).

After verifying proper torque clean area and retest.

Engine dye may be helpful to determine source of leak.

When repair is complete document findings on repair order.

NOTE: This is a temporary fix the permanent service fix is under investigation.

Warranty Information

For vehicles repaired under warranty, use the current labor time for the actual repair made.

Version History

Version	1
Modified	



© 2016 General Motors. All Rights Reserved.