

# **Preliminary Information**

## PIP5551 GF9 Transmission Assembly Setting DTC P2820

### **Models**

Brand:	Model:		Model Years:	VIN:		Engine:	Transmissions:
Diana.				from	to	Lingine.	Tansinissions.
Chevrolet	Malibu		2017 - 2018	ALL	ALL	ALL	M3E
Involved Region or (	Country	North America					
Condition		Vehicle's equipped with a GF9 trans assembly setting a DTC P2820.					
Cause		Possible casting debris in the valve body and/or solenoid body assemblies, or restricted orifice(s) in one or both of the spacer plates.					

#### Correction:

If SI diagnostic's does not lead to a resolution, or debris not found, then replace the solenoid and valve body assemblies with both spacer plates.

Note: Spacer plates should come with the valve body and solenoid body assemblies, but will need to obtain the valve body kit, P/N 24285215, to obtain the fluid passage seals and necessary o-rings.

This concern continues to be investigated and this PI will be updated or advanced to a bulletin, if needed.

### Version History

Version	1
Modified	

