

Please make sure that you need to stop pressing the extend button when the awning reaches its maximum. There are 2 areas that we wanted you to check. The first one will be at the front of the awning when you extend it. That is the awning sensor (pictures 1 & 2). If you can open the awning NOT to its maximum so that it will NOT retract rightaway, remove the screw (shown in picture 2) to see the inside wheel. There will be an arrow on that wheel (shown in picture 1) and that arrow should be pointing upward. If this wind sensor was installed horizontally on the awning. When you removed the cover, the arrow should be straight up, if NOT, you need to point it 12 o'clock.

Pictures 3 & 4 are for the "sensitivity" of the wind sensor module. This is located inside the driver side ottoman/bench seat. You need to lift up the cushion and removed the plywood to access it. As you can see in picture 3, there is another arrow that pints directly at number 5 which is considered "neutral" when it comes to its sensitivity. You may want to lower that to 4 if needed and see what happens.

If NOT, I would advised you to contact Fiamma at 407-672-0091 for diagnosis before you bring it to an RV dealer.

Picture 1



Picture 2



Picture 3



Picture 4

