

Auto High Beam System Indicator, Fog Lights, and Automatic Intermittent Wipers Not Working

AFFECTED VEHICLES

2017-18 CR-V (EX and above)

EDITOR'S NOTE: This article revises the one posted in **October 2017**. Changes are highlighted in yellow.

When installing the shipping fuses, **never** do it with the engine running. If you do, you could wind up with any of these issues:

- With the headlight switch in AUTO, the Auto High Beam System indicator won't come on.
- With the headlight switch in AUTO, the fog lights won't come on with the low beam headlights on.
- The automatic intermittent wipers won't work.

If this is the case, following these steps should restore things to normal:

1. Turn the ignition to OFF.
2. Remove the No. 18 BACKUP (10 A) fuse from the under-hood fuse/relay box.
3. Wait a few minutes, then install the fuse.