

Service Bulletin

18-014

February 22, 2018 Version 1

Capless Fuel Filler (Mis-Fuel Inhibit Device) Leaks When Refueling Vehicle

AFFECTED VEHICLES

| Year | Model | Trim | VIN Range |
|---------|-------|--------|-----------|
| 2016-17 | Civic | 4-door | ALL |

SYMPTOM

Fuel leaks or overflows from the filler neck while refueling.

PROBABLE CAUSE

The auto shut-off feature at the gas pump may be delayed and cause fuel to leak at the filler neck. The capless fuel shutter may also allow excess fuel to leak at the filler neck.

CORRECTIVE ACTION

Replace the capless fuel shutter set. Install the fuel filler lid cover and apply the fuel lid label (if applicable). Refer the customer to page 112 of the Owner's Guide for refueling precautions.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

| Operation Number | Description | Flat Rate Time | Defect Code | Symptom Code | Template ID | Failed Part Number |
|---------------------|--|-------------------|----------------|-----------------|----------------|--------------------|
| 3101U2 | Replace the capless fuel shutter set. Install the fuel lid cover only. | 0.7 hr | 03214 | 03217 | A18014A | 17060-TBA-L01 |
| 3101U2 | Replace the capless fuel shutter set. Install the fuel lid cover and the fuel lid label. | 0.7 hr | 03214 | 03217 | A18014B | 17060-TBA-L01 |

Skill Level: Repair Technician


CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

PARTS INFORMATION


| Part Name | Part Number | Quantity |
|---|---------------|----------|
| Fuel Filler Caution Label (Si models only) | 17669-R9S-A10 | 1 |
| Fuel Filler Lid Cover | 17666-TBA-A01 | 1 |
| Capless Shutter Set (Mis-Fuel Inhibit Device) | 17671-TBA-A02 | 1 |

REPAIR PROCEDURE

1. Remove the mis-fuel inhibit device by breaking the 6 lock tabs.

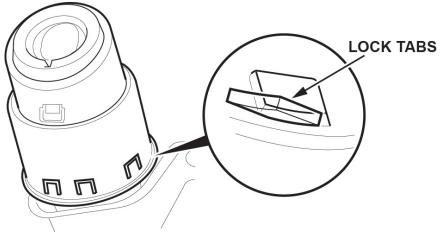


2. Pry up the lock tab and remove the mis-fuel inhibit device.

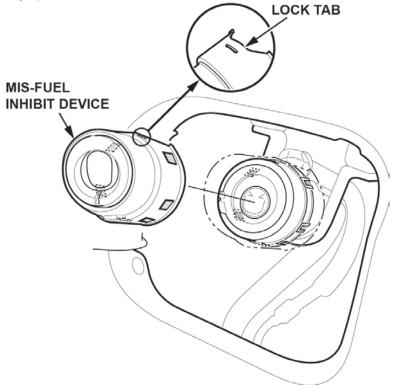

- 3. Install the new mis-fuel inhibit device.
- 4. On Si models only: Apply the fuel lid label to the new fuel lid cover as shown.

NOTE

Make sure the new fuel lid cover is clean and grease-free, especially on the surface where the label will be applied.

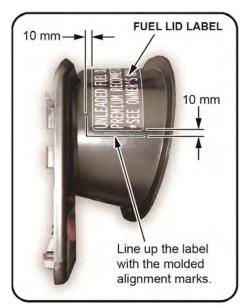



5. Align the hooks on the top edge of the fuel lid cover to the fuel door.






6. Press the bottom of the fuel lid cover to the fuel door until both locking tabs click. This indicates the fuel lid cover is securely and correctly installed.



7. Make sure the fuel door closes and latches without contact or interference from the mis-fuel inhibit device and surrounding area. The gap between the door and the surrounding quarter panel should remain consistent.



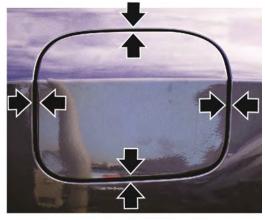

8. Make sure the fuel door release works correctly when using the driver's door switch.

END