

Preliminary Information

 
PIP5558 Clutch Pedal Stays On The Floor - Pedal Does Not Return To Top Of Travel Or Pedal Returns Slowly

Product Investigation Review Required

<u>Models</u>							
Brand:	Model:	Model Years:		VIN:	Engine:	Transmissions:	
				from	to	Liigilie.	Transmissions.
Chevrolet	Cruze	2016 - 2018		Gen II VIN B Built after 1 Feb, 2016	Current	AII	MF3 MZ4 MZ0 M60
Involved Region or Country: North America							
Condition:			Clutch Pedal stays on the floor, pedal does not return to top of travel or pedal returns slowly.				
Cause:			Debris in orifice				
Correction: Item number 1 in the picture below has a small orifice internally that fluid passes through. If small pieces of debris in the fluid get pushed to or through the orifice then it will restrict oil flow. The debris may restrict the orifice then the pedal return will be affected. Customer may notice any of the following concern: Pedal stays on the floor, pedal does not return to top of travel or pedal returns slowly.							
•	tem numbe		•	condition and trying to isolate the root caus tape a plastic bag over each end of the line t			•

ease note that items 2 and 3	below are part of the line and car	nnot be obtained independently of each other.

-	lave Cylinder line and that seal 4 stays on the high pressure line. If II be induced and if seal 4 stays in the master cylinder and a second



Parts Information

Warranty Information

Labor Operation	Description	Labor Time
8430540	Clutch Actuator Cylinder Pipe Elbow Replacement	Use Published Labor Operation Time

Version History

Version	1
Modified	Created on 2/27/2018



















