ATTENTION: GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER	Should Read and Initial in the boxes provided right	UALITY DRIVEN® SERVICE
APPLICABILITY: SUBJECT:	2014-2017MY Forester Front Door Glass Shudder- Design Change to Window Regulator	NUMBER:07-130-18DATE:01/22/18

INTRODUCTION:

This bulletin describes a design change to the center bracket component of the window regulator assembly. The change was made to address customer concerns of the front door glass shuddering while opening or closing. Moisture accumulation in the run channels can cause a stick-slip / vibration condition as the glass goes up and down resulting in the shudder.

PRODUCTION CHANGE INFORMATION:

The new window regulators were incorporated into production starting with VIN H*591720.

PART INFORMATION:

Description	Part Number	Right / Left Hand	Applicability
	61041SG002	R/H	WITH One-Touch Auto Up/Down
REGULATOR & MOTOR ASSEMBLY-FRONT	61041SG012	L/H	
REGULATOR & MOTOR ASSEMBLIFRONT	61041SG022	R/H	WITHOUT One-Touch Auto Up/Down
	61041SG032	L/H	

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

ISO 14001 Compliant ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Subaru of America, Inc. is