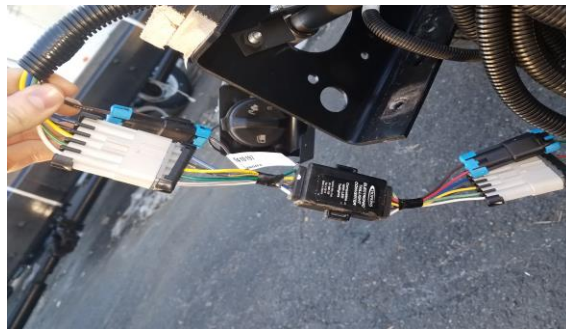
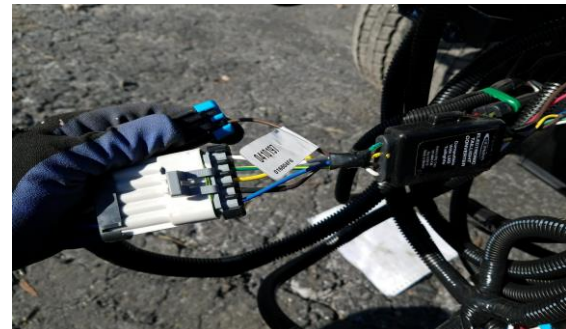


	Field Repair Work Instruction No. FRWI - 517	Rev. NR	Page 1 of 2
	Remove “Hopkins Electronic Taillight Converter Harness” from Chassis and Replace with Part # 04101971		
Identify Process Owner: Warranty, Product Engineering		Document Control Administrator: Quality Department	

1.0	Field Repair Work Instruction Replace “Hopkins” Electronic Taillight Converter Harness (1/2 hour labor allowance @ \$68/hr. + \$5 applicable shop supplies)		
2.0	STEP 1: Upon Notification of a affected unit: Immediately Email MorganCampaign@morgancorp.com for a replacement harness (Morgan Part # 04101971) ➤ Please allow for up to 2 business days to receive the replacement harness		
3.0	STEP 2: Removing and Replacing Harnesses Part A: Locating the converter Harness This part is a small black plastic module with “Hopkins Electronic Taillight Converter” marked on one side. Converter will be a plug n play harness, -identifiable with Metri-Pac connectors at both ends and will be located between the chassis cab and the taillight harness (typically found inside Chassis Frame rail at rear). Part B: Replace Converter harness with Morgan supplied harness Disconnect Metri-Pac connectors at each end to remove converter harness from vehicle Reconnect Metri-Pac connectors and tug on each connection to ensure a secured fit** Re-secure harness with wire ties to original location Confirm that Lights are operational and compliant to FMVSS-108.	  	
4.0	STEP 3: Return Old Harness In order to be reimbursed for the work, the removed harness must be returned. Ensure that the removed part is identified with the Morgan Van Body Serial #. UPS ACCT# 440307 REF: RGA # 222715x1 Grote Industries LLC ATTN: Delmar Sattlewhite 2600 Lanier Drive Madison, IN 47250 PH 812-273-8698		

Issue Date:

Revision Date:

	Field Repair Work Instruction No. FRWI-517	Rev. NR	Page 2 of 2
	Remove “Hopkins Electronic Taillight Converter” from Chassis Harness		

Issue Date:
Revision Date: