

H082NAS1

TECHNICAL BULLETIN

02 MAR 2018



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION**SECTION:**

204-02: Rear Suspension

SUBJECT/CONCERN:

Service Action: Rear Stabilizer Bar - Incorrect Specification

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
E-PACE (X540)	2018	Z05616-Z06671	Graz (Austria)

MARKETS:

CONDITION SUMMARY:**SITUATION:**

An issue has been identified on certain vehicles within the listed Affected Vehicle Range where the rear suspension stabilizer bar bushes have been manufactured away from the required specification, causing insufficient clearance between the rear suspension stabilizer bar and the rear suspension left coil spring.

ACTION:

Retailers are required to **HOLD** affected new vehicles that are within your control and refrain from releasing the vehicles for **new vehicle sale** pending completion of the Workshop Procedure detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:**NOTE:**

Order only the expected percentage demand of parts identified.

DESCRIPTION	PART NO./SUNDRY CODE	QTY./VALUE	EXPECTED PERCENTAGE DEMAND
Rear stabilizer bar	J9C1225	1	100
Rear stabilizer bar to subframe bolts	XR856633	4	100
Stabilizer bar link upper nut	XR848057	2	100

WARRANTY:**NOTE:**

Use the Jaguar Land Rover claims submission system to make sure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, make sure that **all** outstanding Recall and Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting the Program Code and the relevant Option Code; this will result in payment of the stated time. The SRO and parts information is included for information only. The Option Code(s) that allows for the drive in/drive out allowance may only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Use the Jaguar Land Rover claims submission system to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **28 February 2020** closure date must be submitted or payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PARTS/SUNDRY CODE	QTY./VALUE
H082	A	Stabilizer Bar - Renew	64.35.08	0.8	J9C1225	1
					XR856633	4
					XR848057	2
H082	B	Stabilizer Bar - Renew	64.35.08	0.8	J9C1225	1
					XR856633	4
		Drive in/drive out	10.10.10	0.2	-	-

Normal Warranty policies and procedures apply.

WORKSHOP PROCEDURE:

- 1 Replace the rear suspension stabilizer bar (see TOPlx Workshop Manual section 204-02: Rear Suspension - Removal and Installation - Rear Stabilizer Bar).