




MINI Radio Boost CD Is Resetting Itself and Audio Malfunctions

New information provided by this revision is preceded by this symbol .

This Service Information bulletin replaces SI M65 09 11 **dated August 2012**

What's New:

- Warranty Information section updated

MODEL

R55 (Cooper Clubman, Cooper S Clubman, John Cooper Works Clubman)	R56 (Cooper, Cooper S, John Cooper Works)	R57 (Cooper Convertible, Cooper S Convertible, John Cooper Works Convertible)	R60 (Cooper Countryman, Cooper S Countryman, Cooper S Countryman All4)
Vehicles produced from 08/2010 to 03/2011 with option 6FC (Radio MINI Boost CD)			

SITUATION

Intermittently the radio is resetting by itself, the display is blank, and the audio output makes a loud popping noise or is inoperative.

CAUSE

Internal fault in the radio



CORRECTION

Check fault memory using ISTA

Replace Radio

Program vehicle with ISTA/P



PROCEDURE

Perform diagnostics using the latest ISTA version.

Note: When the ISTA system message displays: Battery voltage only "XX.XX" V. Connect charger.

Please note the displayed battery voltage reading in the repair order comments section.

Important: Fault Code "0xABEB: Error in connection from Diversity to Antennas" can be ignored for this issue; no need to perform the test module.

If no other fault code besides "0xABEB" is stored, replace the radio and program the vehicle.

Note that ISTA/P will automatically reprogram and code all programmable control modules that do not have the latest software.

For information on programming and coding with ISTA/P, refer to CenterNet / Aftersales Portal / Service / Workshop Technology / Vehicle Programming.

PARTS INFORMATION

Part Number	Description	Quantity
Refer to EPC (VIN specific)	MINI Radio BOOST CD	1

WARRANTY INFORMATION

This service information bulletin provides technical, diagnostic and/or repair-related information.

Posted: Monday, February 12, 2018

[Copyright ©2018 BMW of North America, Inc.]