



SURROUND VIEW CAMERA DISPLAYS INCORRECT VEHICLE MODEL




New information provided by this revision is preceded by this symbol .

This Service Information bulletin replaces SI B66 13 17 **dated October 2017**

What's New:

- Model – Added new models.
- Correction: Removed note advising corrected as of 3/2017 in production.

MODEL

G30 (5 Series Sedan)	 G12 (7 Series Sedan)	 G01 (X3)	 G32 (6 Series Gran Turismo)
----------------------	--	--	---

Produced between 11/1/16

With option 5DL - Surround View

Or

5DN – Parking Assistant Plus

SITUATION

After programming the vehicle, the incorrect vehicle model is displayed in the CID (Central Information Display) when surround view camera function is active.

CAUSE

ICAM2 (Integrated Camera) control unit software error.

CORRECTION

Update the vehicle profile using ISTA.

PROCEDURE

For conditions that are similar to the situation described:

1. Connect the vehicle to the current version of ISTA.
2. Perform the service function "Transmit vehicle profile".
3. The service function can be accessed as follows: Vehicle management / Service functions / Driver Assistance / All-round vision camera / Transmit vehicle profile.
4. Once the service function is completed, allow the vehicle to sleep for 5 mins before confirming the correct vehicle model is displayed when the surround view camera is activated.

Always connect a BMW-approved battery charger/power supply (SI [B04 23 10](#)).

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	6653040200	
Labor Operation:	Labor Allowance:	Description:
66 99 000	3 FRU	Work time to perform the service function "Transmit vehicle profile" (Main work)
Or:		
66 99 000	2 FRU	Work time to perform the service function "Transmit vehicle profile" (Plus work – Vehicle already in the workshop)
Or:		
66 99 000	1 FRU	Work time to perform the service function "Transmit vehicle profile" (Associated work – Vehicle already connected to the BMW diagnostic equipment)

Posted: Wednesday, February 14, 2018

[Copyright ©2018 BMW of North America, Inc.]