

Creaking noises from seat cushion length adjustment (SKTE) in vehicles with Memory Package (code 275)

Topic number	LI91.10-P-067673
Version	1
Function group	91.10 Front seats
Date	02-02-2018
Validity	BR 213 with SA code 275 (Memory Package) up to manufacturing date 16.03.2017
Reason for change	
Reason for block	

Complaint:

Creaking noises on loading the electrical seat cushion length adjustment (SKTE) in retracted state. Audible at the front of the thigh/knee pad.

Attachments	
File	Description
Video 1.mp4	Example of noise development

Cause:

Contact between plastic lever of seat cushion and cushion shell (signs of abrasion visible on cushion shell).

Remedy:

- Remove seat cushion cover and seat cushion padding

- Stick felt strips (approx. 10x8 cm) onto cushion shell of seat (see pictures, illustrated without the SKTE lever). It is not necessary to remove the seat for this.

Attachments	
File	Description
Pic.1.jpg	Signs of abrasion on cushion shell. No felt attached.
Pic.2.jpg	Felt strips attached to cushion shell.


Symptoms
Body / Seat / Noises / Grunting

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 983 71 10			Felt	1	Roll material must be cut to the required size.	X

XENTRY TIPS

Attachments

Pic.1.jpg:

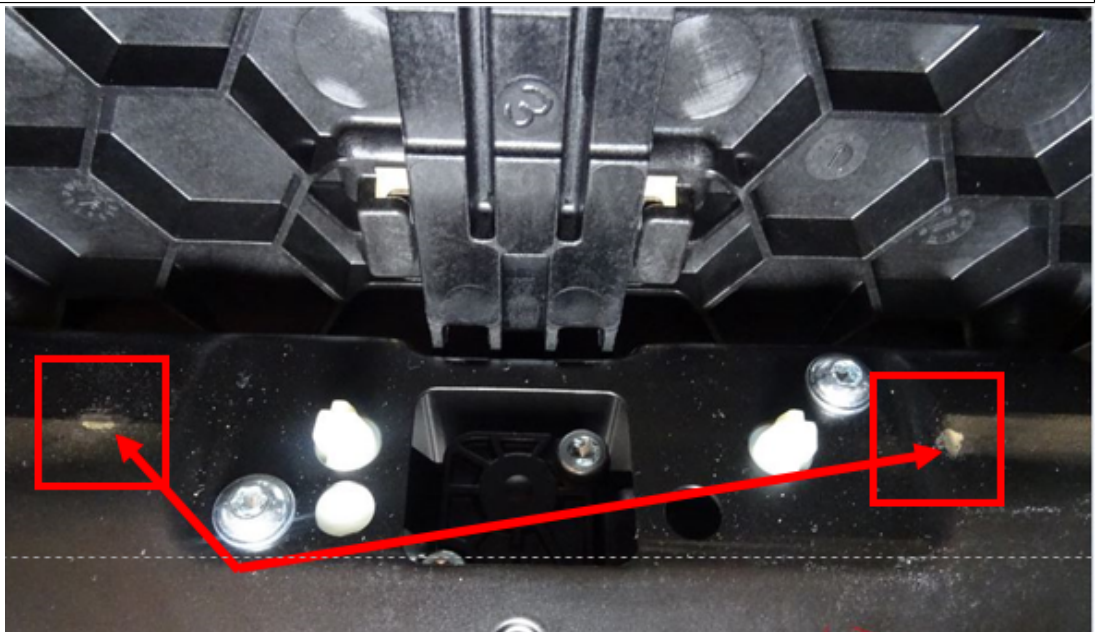

Pic.2.jpg:

