

Height adjustment of electric steering column adjustment nonfunctional

Topic number	LI46.15-P-064685
Version	5
Function group	46.15 Steering column adjustment
Date	02-23-2018
Validity	Model 190 up to vehicle production 31.03.2017 Model 205 up to vehicle production 31.03.2017 Model 213 up to vehicle production 31.03.2017 Model 217 up to vehicle production 31.03.2017 Model 222 up to vehicle production 31.03.2017 Model 231 up to vehicle production 31.03.2017 Model 238 up to vehicle production 31.03.2017 Model 253 up to vehicle production 31.03.2017 Model 463 up to vehicle production 31.03.2017
Reason for change	Validity period added
Reason for block	

Complaint:

Height adjustment of electric steering column adjustment inoperative.

Cause:

Flexible shaft on gearing of height adjustment broken or dislocated.

Attachments	
File	Description
Complaint.mp3	Video of problem

Remedy:

Replace gearing of height adjustment (adjustment repair kit).

Procedure:

1. Remove footwell trim on driver side.
2. Determine variant of height-adjustment and order appropriate replacement part (refer to attachment).
Version A: A 231 460 02 31
Version B: A 213 460 70 00
3. Remove steering column.
4. Remove height adjustment (adjustment repair kit).
5. Install repair kit (adjustment repair kit) (observe tightening torque for bolts in attachment).

XENTRY TIPS

6. Install steering column.

Attachments	
File	Description
Nm.pdf	Bolt tightening torque, adjustment repair kit
Version.pdf	Adjustment repair kit distinguishing feature

Symptoms
Chassis/suspension / Steering system / Steering column adjustment / Nonfunctional
Chassis/suspension / Steering system / Steering column adjustment / Does not adjust in height
Chassis/suspension / Steering system / Steering column adjustment / Clattering
Chassis/suspension / Steering system / Steering column adjustment / Adjusts without obvious cause
Chassis/suspension / Steering system / Steering column adjustment / Knocks

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A2134607000			Adjustment repair kit	1	Repair kit for height adjustment of electric steering column/version: B	
A2314600231			Adjustment repair kit	1	Repair kit for height adjustment of electric steering column/version: A	

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			46281 36	Gearing of steering column adjustment - Noise