

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2017060008, February 2018

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Models 205, 190, and 463 Model Years 2015 - 2016**
Replace ignition coils

Daimler AG ('DAG'), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY15-16 205, 190, and 463 (C-Class, AMG GT-Class, G-Class) vehicles with 8-cylinder spark-ignition engines (M176, M177, M178), it is possible that faulty ignition coils may have been installed. Vibrations and temperature variations could lead to failure at faulty solder points, leading to misfires. An authorized Mercedes-Benz dealer will replace the ignition coils on the affected vehicles.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 2606 vehicles are affected.

Order No. P-SC-2017060008

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Procedure

1. Replace ignition coils.



For model 205 and 463 see **AR15.12-P-2003MNA**



For model 190 see **AR15.12-P-2003MNB**

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
4	Ignition coil	A 177 906 95 00	100%
1	Elastomer gasket, left (only model 190)	A 178 018 02 00	100%
1	Elastomer gasket, right (only model 190)	A 178 018 03 00	100%
2	Sealing ring (only model 190)	A 000 017 00 00	100%



Note

Unless otherwise stated all part numbers should be verified in EPC to insure the part numbers have not changed.

Warranty Information

Operation: Replace ignition coils (20-9759)

Damage Code	Operation Number	Labor Time (hrs.)
15 902 33 7	20-9759(190)	2.1
	20-9759(205 and 463)	1.5



Note

Operation Number labor times are subject to change.