



Technical Information Bulletin

02-140



Section

Cab - 02

Subject

T680 Washer Reservoir Leak

Release Date

3/23/2018

Condition

The top drivers-side fan ring support bracket may rub through the washer reservoir, causing a leak.

Chassis Affected

Affects T680 with X15 engine and 2-gallon washer reservoir built from 08/28/2017 through 12/03/2017.

Action

Fix-As-Fail

If a customer comes into your dealership and demonstrates the condition above, replace the washer reservoir and install a new fan ring bracket. Use the procedure below.

Warranty

Through Standard Warranty (excludes Extended Warranty), Kenworth will pay for parts at dealer net plus applicable mark-up and labor:

- 0.5 hours labor to replace the washer reservoir and install the updated bracket. Use Quick Claim Code 02-140.
- File an additional claim for extraordinary circumstances. A quick claim for standard labor must be filed first.

Take-Off Parts Disposition: Destroy take-off parts

CLAIM CODING			
Failure Location:	002-035-022	Work Accomplished:	35
Failure Type:	235	Responsibility Code:	01
SRT Code:	002	Claim Type:	N


Parts

Parts are available from PACCAR Parts.


Quantity	Part Number	Description
1	F85-1554	Fan ring bracket
1	HK197001	2-gallon washer reservoir
2	TWS0007	Washer fluid

Procedure

1. Confirm that the washer reservoir has a leak caused by the top drivers-side fan ring support bracket rubbing on the reservoir.

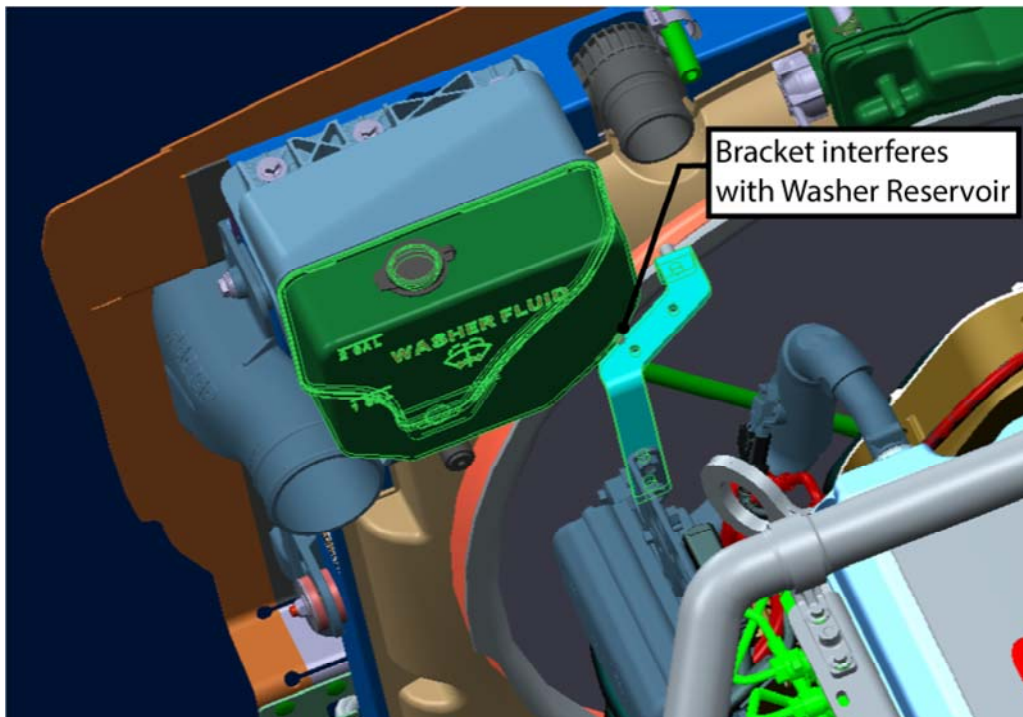

2. Remove the washer reservoir.
3. Remove the top drivers-side fan ring bracket.
4. Install the updated fan ring bracket.
5. Install the new washer reservoir.
6. Confirm there is at least 1 in. (25 mm) clearance between the bracket and the reservoir.

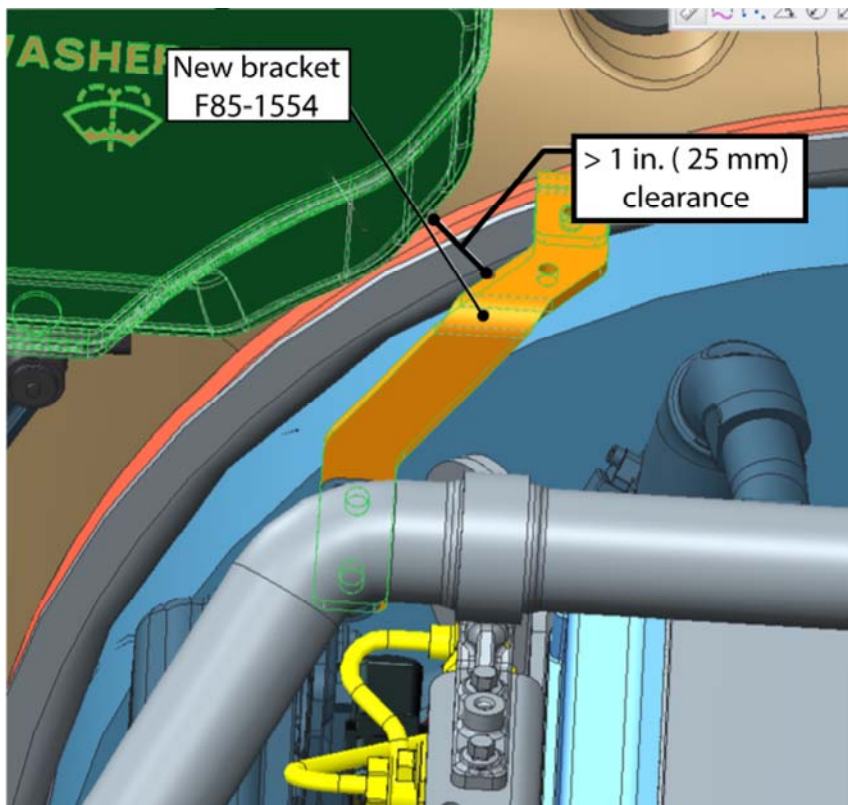

7. Fill the washer reservoir.

Authored by: OF

Access to PACCAR's Enterprise Portal is provided as a benefit of doing business with PACCAR. All applications and content accessed through this system are confidential and proprietary and the property of PACCAR Inc and its suppliers, and must be kept strictly confidential pursuant to the contract licensing such access. Disclosure, publication, release or distribution of any material found on PACCAR systems to any person other than employees with a need to know such information is strictly prohibited. All activity on this system is monitored. If PACCAR suspects or discovers any unauthorized activity, access may be immediately terminated without prior notification. Violators may be subject to legal action.

© Copyright 2018 PACCAR Inc. All rights reserved. We welcome your [feedback](#) on this page. For technical questions or concerns about this page, please contact the [DealerNet Webmaster](#).