



TECHNICAL CAMPAIGN

Side Case Release Lever

K 1600 B (K61, 0F53)

Service Information No. **SI 46 001 18**

Leadership circle

Marketing

Sale
New motorcycles

Sale
Used motorcycles

Aftersales

Administration

Service Information No. SI 46 001 18

Side Case Release Lever

Situation

BMW Motorrad quality analysis has established that on K 1600 B (K61) models with central locking system (SA 417) in rare circumstances the side case could open while driving.



Fig. Release lever

Vehicles affected

In order to determine if a specific vehicle is affected by this Technical Campaign, it will be necessary to verify all VIN's **through AIR** (Aftersales Information Research). Based on the response of the system, either proceed with the repair or take no further action. Please note, VIN's in DCS Vehicle History Check may not appear until 24-72 hours after the release of this bulletin, therefore AIR is the recommended method for determining open campaigns.

Series solution

As of August 14 2017, vehicles produced have been delivered with trouble-free release levers.

Service solution

For affected vehicles, replace the release levers of both cases before delivery or at the next service visit according to repair instructions 46 54 060 Replacing opening flap in Repair and Service Data BMW Motorrad (AIR).

Warranty processing

Defect code

00 46 49 00 00	Replacing the release lever for the case
----------------	--

Flat rate unit number

00 60 329	Replacing opening flaps for case, left and right, 7 FRUs
-----------	--

Part numbers

46 54 8 409 673	Left flap
46 54 8 409 674	Right flap

Questions regarding this bulletin?

For technical inquiries in relation to this bulletin	Please contact the PuMA team
For warranty inquiries in relation to this bulletin.	Submit an IDS ticket to the Warranty Department
For parts inquiries in relation to this bulletin	Submit an IDS ticket to the Parts Department