



GROUP  
Electrical

MODEL  
2017-2018MY  
Niro (DE P/HEV)

NUMBER  
PS556

DATE  
April 2018



## TECHNICAL OPERATIONS

**SUBJECT:** ENGINE DTC P060500 – ECU ROM ERROR

This article provides information regarding the possible illumination of the malfunction indicator light (MIL) on some 2017-2018MY Niro (DE PHEV and HEV) vehicles with a stored DTC: P060500 (Internal Control Module Read Only Memory / ROM Error). This condition may be difficult to duplicate, and may be due to insufficient contact between the GC101 ground (A) and the vehicle body. Improve the ground connection by cleaning the area of contact of the GC101 bolt (A) to metal (no paint) and by adding an external tooth lock washer (B) between the ground wire and body. Use Wire Harness Repair Kit II (TKL04-A0000) star washer (B) part number TKL04-A5001 or equivalent.

