

Discovery
Sport
RR Evoque
18MY with
Active Exhaust

A customer may
complain of a
Check Engine
Lamp or
Restricted
Performance
Message.

Diagnosis returns DTC P2170-11 "Exhaust Pressure Regulator Vent Solenoid Control Circuit Low - Circuit short to ground". If electrical circuit checks return no issue, place the active exhaust valve in the freezer for several hours then re-install and retest. If this allows for duplication of the fault, replace the valve and submit an EPQR with contact details so we can organize PRR of the original parts.

Under
Investigation