Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

DRIVER AND/OR PASSENGER SEAT WARMER(S) INOPERATIVE - (CLOTH SEATS ONLY)

Bulletin No.: 09-017/18

Last Issued: 04/27/2018

BULLETIN NOTES

This bulletin supersedes the previously issued bulletin(s) listed below. The changes are noted in Red text.

Previous TSBs:	Date(s) Issued:
09-017/18	03/26/2018
09-016/17	04/27/17 and 06/28/17

APPLICABLE MODEL(S)/VINS

2013-2016 CX-5 vehicles equipped with cloth seats


NOTE: 2016 CX-5 ONLY: There is no modified seat cushion available for the front passenger side seat, only the driver's side seat cushion is available.

NOTE: For vehicles equipped with leather seats, go to TSB 09-015/17.

DESCRIPTION

Some vehicles may exhibit inoperative driver and/or front passenger side seat warmer(s) in any mode (High, Mid and Low). This may be caused by repeated load applied to the seat cushion (1) while the seat is occupied. A section of the heater mat (2) just above the reinforcement rod (3) in the cushion pad contacts internal heater mat wire and causes damage (4).

Page **1** of **5**

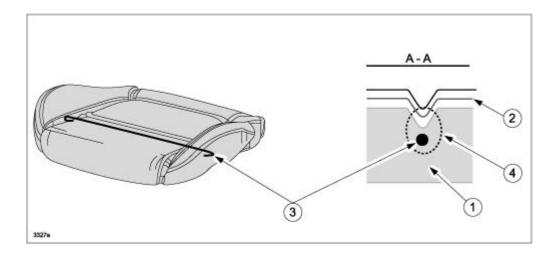

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

- 1. Verify the customer concern.
- 2. Replace the seat cushion pad(s) according to the instructions on MGSS online FRONT SEAT CUSHION TRIM REMOVAL/INSTALLATION.

NOTE:

- A new seat cushion pad is available with a repositioned internal heater mat wire to prevent contact with the reinforcement rod.
- 2016 CX-5: There is no modified seat cushion available for the front passenger side seat, only the driver's side seat cushion is available.
- 3. Verify the repair.


PARTS INFORMATION

Part Number	Description	Qty.	Notes
KEY0-88-11X	Heater and Pad (R), Cushion	1	STC-Cloth B - (2013-2015 CX-5 - Passenger side)
KDY9-88-16X	Heater and Pad (L), Cushion	1	STC-Cloth B - (2013-2015 CX-5 - Driver side)
KAYK-88-16X	Heater and Pad (L), Cushion	1	STC-Cloth D - (2016 CX-5 - Driver side) (There is no modified front passenger side seat cushion available for 2016 CX-5)
KF61-88-1H5 02	Recliner Knob (L)	1	Non-reusable part (Before Nov. 1, 2016 vehicle production)
TK48-88-1H5 02	Recliner Knob (L)	1	Non-reusable part (After Nov. 1, 2016 vehicle production)
KD45-88-1G5 02	Recliner Knob (R)	1	Non-reusable part (Before Nov. 1, 2016 vehicle production)
TK48-88-1G5 02	Recliner Knob (R)	1	Non-reusable part (After Nov. 1, 2016 vehicle production)
KD45-88-857 02	Lifter Knob (L)	1	Non-reusable part
KE08-88-807 02	Lifter Knob (R)	1	Non-reusable part
KD45-88-585	Clip	2 or 4	Non-reusable part

Page 3 of 5

NOTE:

- Use GEPC with VIN to look up the latest part number(s).
- For vehicles equipped with leather seats, go to TSB 09-015/17.

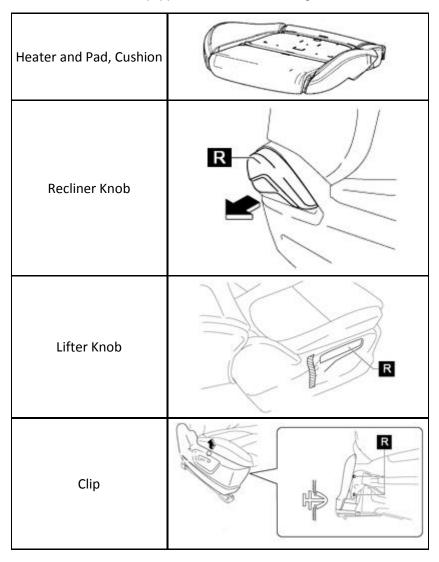

Page **4** of **5**

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	61
Damage Code	9R
Part Number Main Cause	KEYO-88-11X, KDY9-88-16X or KAYK-88-16X (Enter part number of Heater Pad and Cushion applicable to the subject vehicle)
Quantity	1
Operation Number / Labor Hours:	XXMC7ARX / 0.9 Hrs. (Driver side - 2013-2016 CX-5) XXMC7BRX / 1.1 Hrs. (Passenger side - 2013-2015 CX-5) XXMC7CRX / 1.8 Hrs. (Both sides - 2013-2015 CX-5)

NOTE: This bulletin only applies to vehicle with cloth seats.

Page **5** of **5**