

**TECHNICAL SERVICE BULLETIN****18-2090****2.0L Duratec - Illuminated Malfunction Indicator Lamp (MIL) - DTC P0125
At Ambient Temperatures Between -6-0°C (20-32°F)**15 March
2018**Model:**

Ford 2018 EcoSport

Issue: Some 2018 EcoSport vehicles equipped with a 2.0L Duratec engine built on 21-Sep-2017 and through 8-Nov-2017 may exhibit an illuminated MIL with diagnostic trouble code (DTC) P0125 at ambient temperatures between -6-0°C (20-32°F).

Action: Reprogram the powertrain control module (PCM) using the latest Ford Diagnosis & Repair System (FDRS). Make sure you are connected to the internet when entering module programming to obtain the latest updates.

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2018 EcoSport 2.0L Duratec: Retrieve DTCs And Reprogram The PCM	MT182090	Actual Time

Repair/Claim Coding

Causal Part:	RECALEM
Condition Code:	04

Service Procedure

NOTE: ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

© 2018 Ford Motor Company
All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.