

SSM 47138	Some 2018 EcoSport vehicles equipped with a 2.0L Duratec engine may exhibit an illuminated MIL and/or a wrench lamp with diagnostic trouble codes (DTCs) P025A, P0103 and U0109 all present. Inspect for loose connections or pin pushouts at fuse F47, F11 and fuel pump relay located in the battery junction box (BJB). Inspect ground point G300 under front seat for correct torque. If no faults are found in this area, continue with normal diagnostics. Engineering is currently investigating. Monitor OASIS for updates.
--------------	---