

SSM 47159	Some 2016 MKC, MKX and MKZ vehicles built on or before 11/28/2015 and equipped with a TCU may exhibit an intermittent battery draw that can be isolated to the TCU, an inoperative MyLincoln Mobile app, a MyLincoln Mobile app deep sleep message, an inaccurate MyLincoln Mobile app oil life message, an incorrect MyLincoln Mobile app fuel level, a MyLincoln Mobile app false low tire warning and/or Diagnostic Trouble Codes U2100 and/or U2101 stored in the TCU. To correct the condition, program the TCU to the latest calibration using IDS version 108.06 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest calibration. For warranty claiming, use causal part 14G229 and applicable labor operations in the SLTS Manual, Section 10.
--------------	---