	Some 2017 Escape vehicles equipped with a 1.5L EcoBoost engine may exhibit a misfire, lack of
	power, no start and/or illuminated MIL with diagnostic trouble codes (DTCs) P0351, P0352, P0353
	and/or P0354 stored in the powertrain control module (PCM). This concern may be due to a poor
SSM	connection at cylinder head ground G111 near coil on plug (COP) connectors 2 and 3 and body
47180	ground G110 near the turbo on the engine block. Before attempting other repairs, inspect ground
	G111 and G110 to ensure they are clean and properly secured. Refer to Wiring Diagram, Cell 10. If
	these grounds are clean and properly secured to 19 Nm (168 lb-in), proceed with normal Powertrain
	Control/Emissions Diagnosis (PC/ED) Manual diagnostics.