



Preliminary Information

PIT5608 GMC Terrain/Chevy Equinox Seat movement, door lock cycle

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018	All	All	All	All
GMC	Terrain	2018	All	All	All	All
Involved Region or Country:		North America				
Additional RPO/s:		None				
Condition:		Some customers may comment that they hear the door locks cycle on their own, their seat may move randomly without command, problems with the mirror adjustment switches or intermittent PEPS operation.				
Cause:		Short circuit in one or more of the following connectors X500, x600, x700 or x800 due to water intrusion				

Correction:

Check the condition of the x500, x600, x700 or x800 connectors and the mating body harness for signs of water intrusion. Repair as necessary. Evaluate the A-pillar body plug to ensure it is present and sealing properly. Engineering is investigating this sealing issue. If no concerns are observed refer to SI for further diagnosis.

Version History

Version	
1	Created 3/23/2018

