



# Preliminary Information

## PIT5609 SES Lamp with DTC U1345

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2018	All	All	All	All
Chevrolet	Traverse	2017 - 2018	All	All	All	All
Involved Region or Country	North America					
Condition	SES Lamp on with DTC U1345					
Cause	Water getting in connection at the upper and lower Aero Shutters					

### Correction:

Inspect the terminals/connectors at the upper and lower Aero Shutters for water in the connector and/or corroded terminals. If connection is able to be cleaned up, then clean up the connection and apply di-electric to the terminals and before re-install. If the connection cannot be cleaned up, replace the connector and apply di-Electric when before re-installing.

Engineering is still investigating the root cause

**Note: DO NOT CALL GM Technical Assistant Center**

**PI will be updated to a bulletin once the final root is understood**

### Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

### Version History

Version	1
Modified	Created on 3/27/2018

