



# Service Bulletin

File in Section: -

Bulletin No.: 16-NA-159

Date: February, 2018

## TECHNICAL

**Subject:** Squeak, Buzz and/or Rubbing Noise from Steering Column Area

Brand:	Model:	Model Year:		Breakpoint:	Engine:	Transmission:
		from	to			
Chevrolet	Colorado	2015	2018			
GMC	Canyon	2015	2018			

<b>Involved Region or Country</b>	North America
<b>Condition</b>	Some customers may comment on a squeak, buzz and/or rubbing noise coming from the steering column area.
<b>Cause</b>	This condition may be due to the inner and/or outer intermediate steering shaft boots (seals) being out of position.

### Correction



4512167



4381042

Inspect the intermediate steering shaft inner and outer boots (seal) for being out of position as shown above. If the boots are out of position, use a flat trim stick to properly seat the boots.

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7480218*	Inspecting and/or Re-Adjusting Both (Inner and Outer) Intermediate Steering Shafts Boots	0.5 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	3
Modified	June 13, 2016 – Added breakpoint January 29, 2018 – Revised to add 2017–2018 model year and included the word Buzz in the Subject and Condition.

