



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-252

Date: January, 2018

INFORMATION

Subject: Information on Rear Tire Front Air Deflector Missing One Fastener Per Side


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox (VIN X) (Country of Origin, 2: 1st Position of VIN) (Plant Location, 6: 11th Position of VIN)	2018	2019			All	All

Involved Region or Country	North America and N.A. Export Regions
Additional Options (RPOs)	PLANT CODE-INGERSOLL, ONT, CANADA (CAMI) — (NGT)
Condition	During Pre Delivery Inspection (PDI), a technician may find two bolts and an instruction sheet in a loose part bag, and/or may find both rear tire front air deflectors missing one fastener per side.
Cause	The cause of the condition may be that the assembly plant was unable to install the rear tire front air deflector fasteners at these two locations.

Correction

Install both missing rear tire front air deflector bolts (one per side) from the supplied service kit found in the loose part bag. If kit is missing, order a replacement kit using the Parts Information below.

Service Procedure

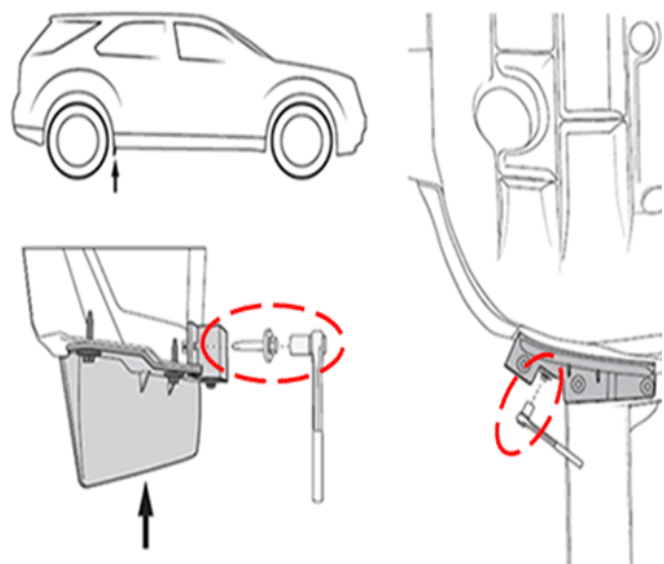

4568517

1. Reaching under the rocker panel, feel along the rear tire front air deflector for the open hole at the **only horizontal** fastener location, shown circled in the illustration above.

2. Install the bolt and tighten to 2.5 N•m (22 lb in).
3. Repeat bolt installation on the opposite side.

Parts Information

Description	Part Number	Qty
ATTACHMENT PKG-RR TIRE FRT AIR DFL	84137728	1, If Necessary

Version	3
Modified	June 15, 2017 – Added VIN Position and RPO designations. January 08, 2018 – Added 2019 model year.

