



# Service Bulletin

File in Section: -

Bulletin No.: 18-NA-002

Date: January, 2018

## TECHNICAL

**Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC's U0073, U0100, U0121, and/or U0140 Set**

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado (VIN S, T)	2017	2018				M5T
GMC	Canyon						

<b>Involved Region or Country</b>	North America
<b>Condition</b>	<p>Some customers may comment that the MIL is illuminated. Some technicians may find one or more of the following DTC's set:</p> <ul style="list-style-type: none"> <li>• U0073</li> <li>• U0100</li> <li>• U0121</li> <li>• U0140</li> </ul>
<b>Cause</b>	This condition may be caused by a poor connection at terminal 7 and/or 8 of the X1 connector and/or terminal 1 and/or 2 at the X2 connector of the Serial Data Gateway Module.
<b>Correction</b>	<div style="text-align: center;"> </div> <p style="text-align: right; font-size: small;">4933222</p> <p>If this concern is encountered, inspect terminals 7 and 8 at the X1 (1) connector and terminals 1 and 2 at X2 (2) connector of the Serial Data Gateway module for poor terminal tension, bent terminals, or backed out terminals.</p>

## Service Procedure

Refer to Repairing Connector Terminals (Terminal Repair) in SI.

Refer to the table below to aid in diagnostics and repair.

Document ID:	Subject:
4744963	K56 Serial Data Gateway Module X1
4744964	K56 Serial Data Gateway Module X2

## Parts Information

No parts are required for this repair.

## Warranty Information

For wiring repairs covered under warranty, please refer to latest version of Bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Version	1
Modified	Released January 02, 2018

