

Service Bulletin

File in Section:

Bulletin No.: 18-NA-082

Date: March, 2018

TECHNICAL

Subject: Rattle Noise from Left Side of Steering Column When Driving Over Rough Roads

	Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
	Branu.	woder.	from	to	from	to		
l	Chevrolet	Camaro	2016	2018			All	All

Involved Region or Country	North America and N.A. Export Regions		
Additional Options (RPOs)	Equipped with HEAD UP DISPLAY-WINDSHIELD (RPO - UV6)		
Condition	Some customers may comment on hearing a rattle noise coming from the left side of the steering column while driving over rough roads.		
Cause	The cause of the condition may be that the Head Up Display (HUD) switch assembly may have excess play to the surrounding bezel, allowing it to rattle.		
Correction	Apply BRS flocking tape to the HUD switch following the steps in the Service Procedule below.		

Copyright 2018 General Motors LLC. All Rights Reserved.

Service Procedure

1. Remove the HUD switch assembly and bezel:



5001949

- 1.1. Using a trim stick, or suitable tool, carefully pry the left (outboard) side of the HUD bezel from the IP.
- 1.2. Once the left side releases from the IP, pull the assembly outboard again to fully detach the assembly from the IP.
- 1.3. Disconnect the electrical connector.



5001951

- 2. Remove the switch assembly from the bezel.
- 3. Cut two 63.5 mm (2.5 in) length pieces of Kent Automotive BRS Tape P/N #13485, or equivalent flocking tape.



5001953

- 4. Apply the tape to BOTH the top and bottom of the switch.
- 5. Reinstall the switch to the bezel.
- 6. Reconnect the electrical connector.



5001954

7. Reinstall the switch and bezel assembly to the IP by positioning the right side retaining tab first, then pushing and fully seating the left side.

Parts Information

Order BRS Tape from Kent Automotive at 1-888-YES-KENT, or online at www.kent-automotive.com.

Description	Part Number	Material Allowance
Kent Automotive BRS Tape	KT 13485 (1 mm thick, 10 mm wide)	42 cents (U.S.) 63 cents (Canada)

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1080588*	Apply BRS Tape to HUD Switch	0.2 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released March 14, 2018