



Service Bulletin

File in Section: -

Bulletin No.: 18-NA-040


Date: February, 2018

INFORMATION

Subject: Noise Originating from Front of Vehicle while Driving or Turning Over Bumps

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Bolt EV	2017	2017			All	All
Opel	Ampera-e	2017	2017			All	All

Involved Region or Country	North America and N.A. Export Regions
Condition	Some customers may comment on a noise originating from the front of the vehicle when driving or when turning over a rough surface.
Cause	This may be due to the front strut upper nut not being torqued to specification.
Correction	Before replacing any front suspension part for noise, check the upper strut nut for the proper tightening specification of 85 N•m (63 lb ft).

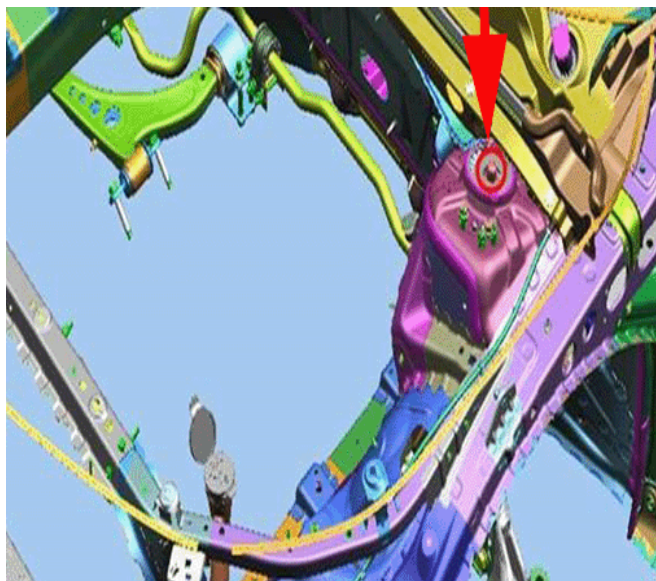

4960668

Version	1
Modified	Released February 6, 2018

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION