



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-110

Date: February, 2018

TECHNICAL

Subject: Low Coolant in Surge Tank and/or Intermittent Low Coolant Message Displayed

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado	2017	2018			L5P	All
GMC	Sierra	2017	2018			L5P	All

Involved Region or Country	North America, Israel
Additional Options (RPOs)	Equipped with Diesel Engine (RPO L5P)
Condition	Some customers may comment on the coolant surge tank appears low and/or a low coolant message displayed intermittently.
Cause	This may be due to the fill process at the plant cannot purge all of the air from the cooling system and surge tank. After the engine has been thermally cycled, air rises causing the coolant to become lower than initially viewed.
Correction	Add 1 quart (0.946 L) of coolant to the upper chamber of the surge tank in order to bring the level up to the bottom of the fill neck.


Examples

Improperly Filled System



4958429

Properly Filled System

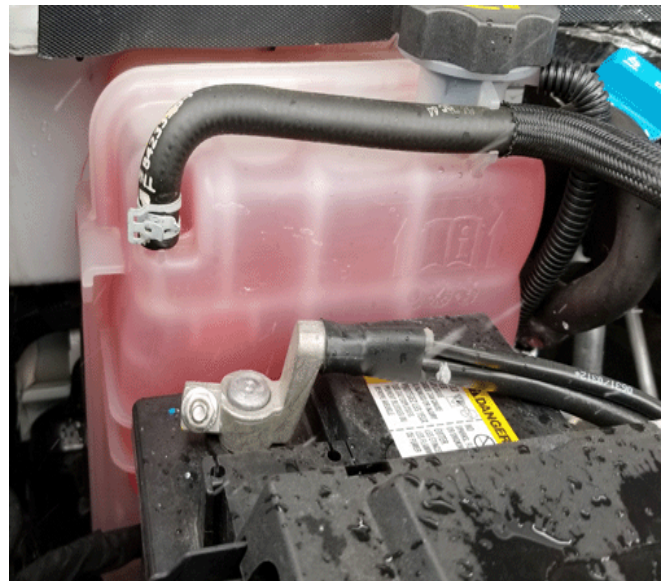

4958431

Parts Information

Description	Qty	Material Allowance
DEX-COOL®	1 Quart	\$3.06 (USD) \$5.71 (CAN)

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4081628*	Add Coolant to Upper Chamber of the Surge Tank	0.2 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	3
Modified	December 04, 2017 — Added 2018 Model Year. February 02, 2018 — Added Illustrations.

