



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-347


Date: March, 2018

INFORMATION

Subject: Diagnostic Tip for Right and/or Left Rear Tail Lamp Inoperative and/or Turn Signals Flashes to Fast

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Enclave	2018	2018				
Chevrolet	Traverse						

Involved Region or Country	North America and NA Export vehicles
Condition	Some customers may comment on the right and/or left rear tail lamp inoperative and/or turn signal flashes to fast.
Cause	 <p>4890855</p>

	
	<p>4890864</p> <p>This condition may be caused when one of the terminals in the tail lamp connector being pulled out of the connector, or the wire being broken at the crimp. Note: In some cases the wire is broken internal to the insulation.</p>
Correction	Replace the tail lamp harness.

Service Procedure

Refer to Tail Lamp Wiring Harness Replacement or Wire to Wire Repair in SI.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Parts Information

Causal Part	Description	Part Number	Qty
X	CONNECTOR ASM-WRG HARN	13578533 (Traverse)	1
		19366645 (Enclave)	

Labor Operation	Description	Labor Time
5430902	Wire-to-Wire Repair	Use Published Labor Operation Time

Version	3
Modified	Released November 06, 2017 January 18, 2018 – Revised to update the Subject including the Condition/Cause/Correction and Warranty Information also adding 2018 Enclave. March 09, 2018 – Updated the Parts Information.



