



Preliminary Information

 
PIP5560A Noise, Engine Failure, or Oil flow DTC's After Oil Filter Was Changed

Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2017 - 2018	All	All	3.6L LGZ	All
GMC	Canyon	2017 - 2018	All	All	3.6L LGZ	All
Involved Region or Country	North America					
Condition	Some customers may come in with an engine concern of noise, SES light, or engine failure shortly after an oil change.					
Cause	This may be caused by a missing oil filter adapter insert that was inadvertently removed during an oil change.					

Correction:


If a vehicle comes in with this condition, inspect the oil filter adapter to ensure the center insert is still present. See below.



 If the insert is present continue with normal SI diagnostics. See below.



 If the insert is missing, order an oil filter adapter, remove the insert from the new oil filter adapter, and install the insert in the existing oil filter adapter.



Note: This PI will be updated as new information and/ or parts become available.

Version History

Version	2
Modified	Created on 3/6/2018. Update repair procedure on 4/11/2018.



© 2016 General Motors. All Rights Reserved.