



Preliminary Information

 
PIC6330 MIL caused by one or more of the following DTCs: P0960, P0962, P0964, P0968, P0970, P2718, P2727

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Volt	2016 - 2018	All	All	L3A	MKV
Chevrolet	Malibu	2016 - 2018	All	All	LKN	MKE
Involved Region or Country		North America				
Condition		The customer may state that the vehicle has the check engine light displayed. Normal SI diagnostics may not be able to detect an intermittent circuit issue.				
Cause		Circuit concerns caused by internal harness quality or Q8 solenoid module quality.				

Correction:

- At this time replace both the internal transmission harness and the solenoid pack (Q8)
- It is okay to use a newer part number.
- This repair can be performed with the transmission remaining in the vehicle. Please follow Service Information for complete Repair steps and other parts that might be needed.
- Verify the date code on the replacement harness is after 02/12/2018 prior to installation.
- This Picture is to show the location of the date on the wiring harness label.



Parts Information

Description	Part Number	Quantity
HARNESS, A/TRNS WRG CONT VALVE SOL	24285319	1
VALVE, CONT SOL (Q8)	24275237	1

Warranty Information

Labor Operation	Description	Labor Time
8463570	Automatic Transmission Wiring Harness Replacement	Use Published Labor Operation Time
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	Created on 04/24/2018



© 2016 General Motors. All Rights Reserved.