

# Technical Information 911 (996) 18/17 ENU 4075

#### Front Axle Coil Spring

Vehicle Type: 911 Carrera (996)/911 Targa (996)/911 Millennium (996)

911 Carrera 4 (996)/911 Carrera 4S (996)

Model Year: As of 1998 up to 2005

Subject: Replacing the coil spring on the front axle during repairs

Information: Coil spring for the respective chassis **no longer** available.

Notes: During repairs, the faulty coil spring will be replaced by a new coil spring of similar design. A spring plate

(compensation part) may also have to be used (see Part Info table).

The new coil spring has the same function as the coil spring installed in the vehicle.

A faulty coil spring must always be replaced on both sides of the axle.

Existing sets containing a coil spring that is no longer available will be interpreted into new sets.

Parts Info:

The table below shows how the old coil springs (sets) are interpreted into the new coil springs (sets) and which spring plate (compensation part) may also have to be used:

| 911 Carrera (996)/911 Targa (996)/911 Millennium (996) |                |                                   |  |  |
|--|----------------|-----------------------------------|--|--|
| Coil spring  |                | Caring plate (companyation part)  |  |  |
| Currently  | New            | Spring plate (compensation part)  |  |  |
| 986.343.531.05   | 986.343.531.01 | 996.343.511.03 – 8 mm, color: red |  |  |
| 986.343.531.07   |                |                                   |  |  |
| 986.343.531.06   | 986.343.531.02 | 996.343.511.03 – 8 mm, color: red |  |  |
| 986.343.531.08   |                |                                   |  |  |
| 996.343.531.02   | 996.343.531.01 | 996.343.511.03 – 8 mm, color: red |  |  |
| 996.343.531.15   |                |                                   |  |  |
| 996.343.531.16   |                |                                   |  |  |
| 996.343.531.03   | 996.343.531.04 | 996.343.511.03 – 8 mm, color: red |  |  |
| 996.343.531.17   |                |                                   |  |  |
| 996.343.531.18   |                |                                   |  |  |

4075 ENU 18/17

## **Technical Information**

| 996.343.531.11 | 996.343.531.12 | No spring plate (compensation part) required |
|----------------|----------------|--|
| 996.343.531.19 |                |  |
| 996.343.531.23 |                |  |
| 986.343.531.11 | 996.343.531.12 | 996.343.511.03 – 8 mm, color: red            |
| 996.343.531.20 |                |  |
| 986.343.531.15 | 996.343.531.13 | No spring plate (compensation part) required |
| 996.343.531.14 | 996.343.531.13 | 996.343.511.03 – 8 mm, color: red            |
| 996.343.531.21 |                |  |
| 996.343.531.22 | 986.343.531.12 | No spring plate (compensation part) required |
| 986.343.531.16 | 986.343.531.12 | 996.343.511.03 – 8 mm, color: red            |

| 911 Carrera 4 (996)/911 Carrera 4S (996) |                |  |  |  |
|--|----------------|--|--|--|
| Coil spring                              |                | Caring plate (companyation part)             |  |  |
| Currently                                | New            | Spring plate (compensation part)             |  |  |
| 996.343.533.05                           | 996.343.533.04 | 996.343.525.02 – 7.5 mm, color: brown        |  |  |
| 996.343.533.20                           |                |  |  |  |
| 996.343.533.21                           |                |  |  |  |
| 996.343.533.32                           |                |  |  |  |
| 996.343.533.06                           | 996.343.533.07 | No spring plate (compensation part) required |  |  |
| 996.343.533.22                           | 00/ 040 500 07 | 996.343.525.02 – 7.5 mm, color: brown        |  |  |
| 996.343.533.23                           | 996.343.533.07 |  |  |  |
| 996.343.533.15                           | 996.343.533.14 | 996.343.525.02 – 7.5 mm, color: brown        |  |  |
| 996.343.533.24                           |                |  |  |  |
| 996.343.533.25                           |                |  |  |  |
| 996.343.533.33                           |                |  |  |  |
| 996.343.533.16                           | 996.343.533.17 | No spring plate (compensation part) required |  |  |
| 996.343.533.26                           | 996.343.533.17 | 996.343.525.02 – 7.5 mm, color: brown        |  |  |
| 996.343.533.27                           |                |  |  |  |
| 996.343.533.18                           | 996.343.533.30 | No spring plate (compensation part) required |  |  |
| 996.343.533.19                           | 996.343.533.31 | No spring plate (compensation part) required |  |  |
| 996.343.980.13                           | 996.343.980.26 | No spring plate (compensation part) required |  |  |

Tools: VAS 6908 - Stationary Spring Compressor

Work Procedure: 1 Preparatory work

- 1.1 Raise the vehicle and remove wheels on the front axle.
- 1.2 Remove front spring strut ( ⇒ Workshop Manual '408519 Removing and installing front spring strut')



Preloaded or pressurized components

- · Risk of pinching or bruising
- ⇒ Do not reach into the danger area.
- ⇒ Relieve the tension on components before starting work.
- ⇒ Secure components to prevent them from loosening suddenly.
  - 1.3 Disassemble front spring strut ( ⇒ Workshop Manual '4000 Disassembling and assembling front spring strut')



#### Information

- When installing new parts, refer to the allocations described in the Porsche Electronic Parts Catalog (PET).
- A different spring plate (compensation part) than the one used before may have to be used.
- 2 Assembling spring strut

Exploded view of spring strut on front axle

- Shock absorber
- 2 NEW coil spring
- 3 Protective bellows
- **4** Additional spring
- **5** Cone washer
- Spring plate (compensation part, depending on coil spring)
- 7 Support ring
- 8 Deep-groove ball bearing
- **9** Stop plate
- **10** Spring strut supporting mount
- 11 Stop plate
- **12** Lock nut M14 x 1.5


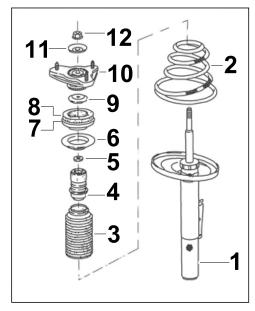


Figure 1

- 2.1 Assemble spring strut as follows (see also ⇒ Figure 1):
  - 1 Protective bellows
  - 2 Additional spring
  - 3 Cone washer
  - 4 Stop plate
  - 5 Shock absorber piston rod
  - 2.1.1 Attach protective bellows to additional spring and fit on piston rod (⇒ Figure 2).
  - 2.1.2 Push cone washer and stop plate as Figure 2 far as they will go onto the piston rod at the correct position ( $\Rightarrow$  Figure 2).

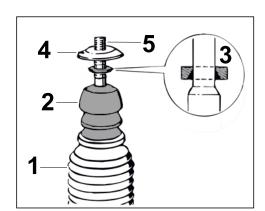

## **WARNING**

Preloaded or pressurized components

- Risk of pinching or bruising
- ⇒ Do not reach into the danger area.
- ⇒ Relieve the tension on components before starting work.
- ⇒ Secure components to prevent them from loosening suddenly.
  - 2.1.3 Pre-tension new coil spring using spring tensioner ( $\Rightarrow$  *Figure 3*).
    - 1 New coil spring
    - 2 Spring tensioner
  - 2.1.4 Position new coil spring on the shock absorber as shown in Figure 3 (⇒ Figure 3). The end of the coil spring is touching the stop on the concave washer.

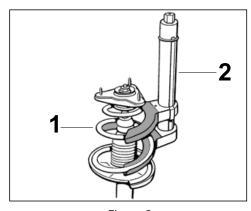


Figure 3

18/17 ENU 4075

2.1.5 **ONLY** for the relevant coil spring (see table):

Press spring plate (compensation part  $\Rightarrow$  Figure 4 -1-) into the support ring/deep-groove ball bearing assembly ( $\Rightarrow$  Figure 4 -2-).

- Spring plate (compensation part)
- Support ring/deep-groove ball bearing assembly
- 3 Spring strut supporting mount

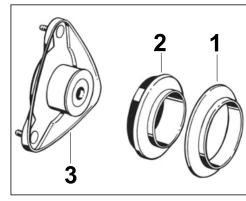


Figure 4

- 2.1.6 Complete support ring/deep-groove ball bearing/spring plate (compensation part) assembly with spring strut supporting mount.
- 2.1.7 Fit spring strut supporting mount assembly on the piston rod. Make sure that the end of the coil spring is inside the spring plate (underside of spring strut supporting mount).
  - Spring strut/supporting mount assembly
  - **2** End of coil spring
- 2.1.8 Position stop plate at the correct position above the spring strut supporting mount and fit new lock nut (M14 x 1.5) on the thread of the shock absorber piston rod.

Tightening torque 80 Nm (59 ftlb.)

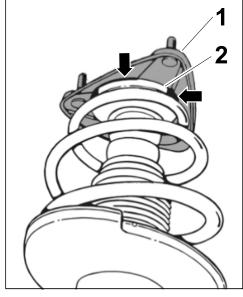


Figure 5

- 3 Concluding work
  - 3.1 Install front spring strut ( $\Rightarrow$  Workshop Manual '408519 Removing and installing front spring strut')
  - 3.2 Fit wheels on the front axle and lower the vehicle.
  - 3.3 Check wheel alignment values on the front axle and make adjustments if necessary.

40 85 20 00: **ONLY** for 911 Carrera (996)/911 Targa (996)/911 Millennium (996):

### **Technical Information**

Labor time: 220 TU

—Front spring strut (2 ea.) removed and installed—

Includes: Removing and installing wheels, loosening and securing lower

control arms,

loosening and securing connecting link on anti-roll bars, front

brake calipers and tie rods

Without: Performing suspension alignment and adjusting the vehicle.

Separate LO no.!

40 85 20 00: **ONLY** for 911 Carrera 4 (996)/911 Carrera 4S (996):

—Front spring strut (2 ea.) removed and installed— Labor time: **270 TU** 

Includes: Removing and installing wheels, loosening and securing lower

control arms

loosening and securing connecting link on anti-roll bars, front

brake calipers and tie rods

Without: Performing suspension alignment and adjusting the vehicle.

Separate LO no.!

40 85 38 50: —Front spring strut (2 ea.) disassembled and assembled— Labor time: **80 TU** 

Includes: Removing and installing coil spring

44 85 03 00: **ONLY** for 911 Carrera (996)/911 Targa (996)/911 Millennium (996):

—Front suspension alignment performed— Labor time: **70 TU** 

Includes: Checking height, camber, toe, caster and toe difference angle

Without: Adjusting vehicle at the front. Separate LO no.!

44 85 03 00: **ONLY** for 911 Carrera 4 (996)/911 Carrera 4S (996):

—Front suspension alignment performed— Labor time: **90 TU** 

Includes: Checking height, camber, toe, caster and toe difference angle

Without: Adjusting vehicle at the front. Separate LO no.!

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2018 Porsche Cars North America, Inc.