



Technical Service Bulletin

64 Rear quarter glass intermittently retracts after closing convertible top

64 18 52 2048934/2 March 2, 2018. Supersedes Technical Service Bulletin Group 64 number 17-44 dated September 26, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A5 Cabriolet	2018	000001 - 005042	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Added filters) Revised <i>Service</i> (Updated SVM table versions)
1	09/26/2017	Initial publication

After closing the convertible top, the rear quarter glass rolls down automatically. Condition occurs intermittently, and can occur on one, or both rear quarter glass.

Technical Background

Not applicable.

Production Solution

New software in the front passenger door control module, J387 (address word 0052) and driver door control module, J386 (address word 0042) addressed the condition.

Service

SVM Update Instructions

1. Follow all instructions in the attached TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the front passenger door control module, J387 (address word 0052) and driver door control module, J386 (address word 0042) using the SVM action code as listed in the table below if necessary:



Technical Service Bulletin

Model	Control Module Diagnostic Address	Old Software Part Number	New Software Part Number	New Software Version (or higher)	SVM Code Input
A5 Cab 2018 S5 Cab 2018	0042	4M0.959.793.F 4M0.959.793.H	4M0.959.793.H	0129	42A014
A5 Cab 2018 S5 Cab 2018	0052	4M0.959.792.F 4M0.959.792.H	4M0.959.792.H	0129	42A014

3. Perform basic settings of all four windows.

Warranty


Claim Type:	• 110 up to 48 Months/50,000 Miles • G10 for CPO Covered Vehicles – Verify Owner • If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6438		
Damage Code:	0039		
Diagnostic Time:	GFF – (software update(s))	0150 0000	Time stated on diagnostic protocol (Max 100 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2048934/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

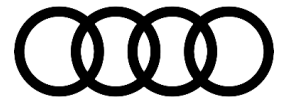

Technical Service Bulletin

All parts and service references provided in this TSB (2048934) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.