

Technical Service Bulletin

80 Whistling noise from center area of instrument panel

80 18 09 2050693/1 March 9, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2017 - 2018	All	Not Applicable

Condition

Customer states:

• They hear a whining noise in the central area of the instrument panel. The noise occurs when the engine is either engaged in a driving range or at idle with the engine rpm between 2000 and 2800 rpm.

Technical Background

The noise occurs when the engine is either engaged in a driving range or at idle with the engine rpm between 2000 and 2800 rpm. The noise is found to be created by the coolant flow through the heater core as the engine speed changes causing a pressure and flow change in the cooling circuit.

Production Solution

Not applicable.



Technical Service Bulletin

Service

Duplicate the noise with the engine fully warm and raise the engine speed between 2000 and 2800 rpm. If the noise is duplicated block off the coolant flow to the heater core using a pair of automotive hose pinch pliers or a 3094 hose clamp. If the noise is eliminated the heater core is confirmed as the root cause of the noise.

Replace the heater core.



Figure 1. Heater core coolant flow blocked using a 3094 hose clamp.

Warranty

Claim Type:	 Type: 110 up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. 				
	If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	: 8023				
Damage Code:	0010				
Labor Operations:	Shelf under dash panel remove and reinstall	68 18 19 00	30 TU		
	Heater core remove and reinstall	80 23 19 50	160 TU		
Diagnostic Time:	GFF	No allowance	0 TU		
	Road test prior to service procedure	0121 0002	10 TU		
	Road test after service procedure	0121 0004	10 TU		
Claim Comment:	As per TSB #2050693/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

Part Number	Part Description	Quantity
3094 (or equivalent tool)	Hose Clamps	1
1K0819031D	Heater Core	1

Additional Information

All parts and service references provided in this TSB (2050693) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.