



Technical Service Bulletin

96 Audi side assist or cross traffic assist (lane change assistant) activates with false warnings

96 18 24 2050818/1 March 22, 2018.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, Q7	2017 – 2018	All	With lane change assist or With lane change system and lane departure warning
A5, Q5	2018	All	With lane change assist or With lane change system and lane departure warning

Condition

Customer states:

- False warnings are activated (visual and auditory) from the lane change assist (Audi side assist or Audi cross traffic assist).

Technical Background

New software implemented to address false warnings.

Production Solution

New software in the lane change assistant control module, J769 (address word 003C) and the lane change assistant 2 control module, J770 (address word 00CF) addressed the condition.

Service

SVM Update Instructions

- Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
- Update the lane change assistant control module, J769 (address word 003C) and the lane change assistant 2 control module, J770 (address word 00CF) using the SVM action code as listed in the table below, if necessary:



Technical Service Bulletin

Model	Diagnostic Address	Old Hardware Part Number	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version	SVM Code Input
A4, A4 allroad, A5, A5 Cab, A5 Sportback, Q5, and Q7	003C	4M0907566	4M0907566	160	4M0907566D	410	3CA014
				161			
		4M0907566B	4M0907566	*			
	00CF	4M0907590	4M0907590	160	4M0907590D		
				161			
		4M0907590B	4M0907590	*			

Warranty

Claim Type:	<ul style="list-style-type: none">110 up to 48 Months/50,000 Miles.G10 for CPO Covered Vehicles – Verify Owner.If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9635		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	Time stated on diagnostic protocol (Max 100 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2050818/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2050818) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.