

TECHNICAL UPDATE 2018-01



Notice Information

Ref	5853
Posted Date:	
Posted To:	General Manager / Business Owner, Technician, Aftersales Manager, Service Leader / Advisor, Accounts / Admin
Subject:	Service/Technical

TOL NOTICE (US&CAN) – February 6, 2018

Technical Update 2018-01

We have noticed an issue of clutch cable wear affecting certain Bonneville Bobber models (Up to VIN 863366). The customer may see evidence of this issue appear as marks to the outer sleeve of clutch cable.

After carrying out internal testing, we have identified the cause of this wear is due to the clutch cable rubbing against the clutch cable guide, which is attached to the front fork. To alleviate this issue, we have introduced a revised clutch cable guide . A kit including a replacement clutch cable, revised clutch cable guide and all relevant fixings can now be ordered off EPC.

If a customer complains of this issue, please replace using the part No.T2021648. Triumph will cover replacement under warranty. Please use fault code 02045511 and repair code 12043301. A Technical News addressing this issue will release in the coming days.

What is the nature of concern?	Wear to clutch cable outer sleeve.
Models Affected:	Bonneville Bobber (DV)
VIN Range:	Up to VIN 863366
What is the impact to the customer?	There is no safety, performance or reliability impact. It is a cosmetic issue.

If you have any questions, contact your Regional Manager or call Triumph 24/7 Customer Support at (888) 284-6288.